

Administration Building 117 N. Second Street Goshen, Indiana 46528

Goshen Administration Building


2024

Location		Structural Inconsistencies		Recommended Corrections/Modifications to Provide Access	Technical Information			Finalized Actions		
Location 1. Ramps	Photo 1	Identified Issue Ramps longer than 6 feet, do not have railings on both sides, right side only.	 ADAAG Specification 	ADAAG requires hnadrails on both sides of a ramp if the ramp run has a rise greater than 6 inches or a horizontal projection greater than 72 inches. Add handrail to left side.	L: Ramp slope is accessible and handrail is provided on one side.	Improvement Cost	ອງ ກາວ Buippung Elkhart County General Fund	Finalized Correction	Anticipated Date of Completion	Date of Completion
2. Ramps	1	Ramps are not non-slip.	4.5.1	ADAAG requires ground and floor surfaces along accessible routes and in accessible rooms and spaces including floors, walks, ramps, stairs, curb ramps, shall be stable, frim, and slip-resistant. Add non-slip surface material.	M: Could add sign about slippery surface in mean time.	\$1,000	Elkhart County General Fund	Slip resistant material installed.		Sep-14
3. Parking		No "Van Accessible" sign at van accessible parking space. No enforcement procedure for accessible parking.		ADAAG requires accessible parking spaces to be located in each parking lot. Accessible parking spaces are required to have upright signage that incluces the symbol of a accessibility and van accessible signage where required. Add one "Van Accessible" sign. Enforce parking regulations.	L: Van spaces are provided, just no signage. May be snow in the way and not known w/out signs.	\$50	Elkhart County General Fund	Van accessible sign installed		Jul-14
4. Entrance	4	Edges are not securely installed to help minimize tripping hazards.		ADAAG requires if carpet or carpet tile is used on a ground floor or surface, than it shall be securely attached. Secure carpetingor mats at edges.	H: This can easily be fixed with little cost.	\$50	Elkhart County General Fund	All removed		Jul-15

Goshen Administration Building

2024

Location		Structural Inconsistencies		Recommended Corrections/Modifications	Technical Information			Finalized Actions		
				to Provide Access						
Location 5. Counters	Photo 2	Identified Issue At each type of cashier counter, there is a portion of the maincounter that is greater than 36 inches high.	5.4 ADAAG Specification	ADAAG requires in areas used for transactions where counters have cash registers, at least one of each type shall have a portion of the counter which is at least 36 inches in length with a maximum height of 36 inches above the finish floor. Lower section of the counter.	M: Majority of customers use these counters. L: in some cases when cashiers can easily walk around.	Cost Cost	aunos Bulipung Elkhart County General Fund	Finalized Correction Some counters removed	Anticipated Date of Completion	Date of Completion
6. Drinking Fountain	6	Drinking fountain does not have minimum clear floor space of at least 30 by 48 inches in front.	4.15.5	ADAAG requires fountains have a minimum clear floor space of 30 by 48 inches to allow a person in a wheelchair to approach the unit facing forward. Clear more room in order to meet minimum requirements.	L: Drinking	\$150	Elkhart County General Fund	Remove	2023	
7. Drinking Fountain	6			ADAAG requires spouts shall be no higher than 36 inches, measured from the floor to spout outlet. Controls shall comply with 4.27.4 (Operable with closed fist). Unit controls shall be front mounted or side mounted near the front edge. Replace controls and lower fountain height. (or remove fountain)	L: Drinking fountains are not required.	\$150	Elkhart County General Fund	Remove	2023	

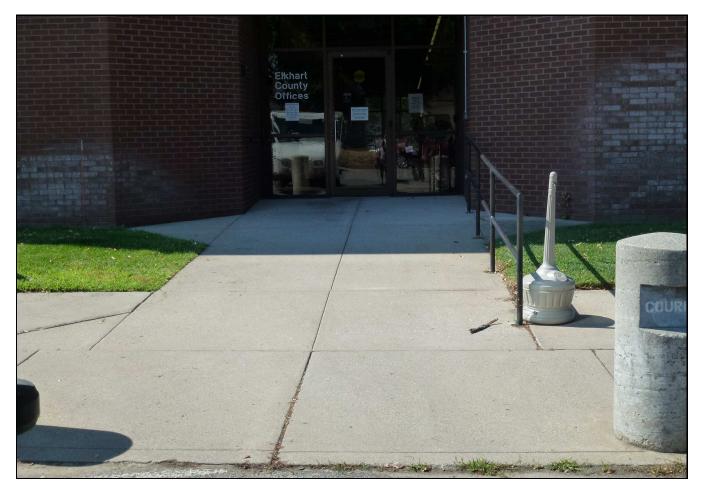

01.Goshen Admin Ramp



02.Goshen Admin Parking



03.Goshen Admin Outside Sign





05.Goshen Admin Counter

