



Health Department, Elkhart
608 Oakland Avenue
Elkhart, Indiana 46516

Location		Structural Inconsistencies		Recommended Corrections/Modifications to Provide Access	Technical Information			Finalized Actions		
Location	Photo	Identified Issue	ADAAG Specification		Priority Ranking and Justification	Improvement Cost	Funding Source	Finalized Correction	Anticipated Date of Completion	Date of Completion
1. Parking	1, 2	No "Van Accessible" sign at van accessible parking space. No enforcement procedure for accessible parking	4.6.4	ADAAG requires accessible parking spaces to be located in each parking lot. Accessible parking spaces are required to have upright signage that includes the symbol of a accessibility and van accessible signage where required. Add one "Van Accessible" sign. Enforce parking regulations.	L: Space is adequate for vans, just no sign posted.	\$50	Elkhart County General Fund	Van accessible sign installed		Jul-14
2. Entrance	3	Rugs at entrance are not secure to ground and may cause tripping hazard	4.5.3	ADAAG requires all carpet and rug edges to be securely fastened to the ground. Replace rugs with edges that are fastened or stick to the floor to minimize tripping hazard.	L: Minimal trip hazard is present.	\$100	Elkhart County General Fund	Rugs removed		Jul-15
3. Signage for goods and services, entire building	4, 5	Signs are mounted too high and some do not contain Grade II Braille	4.30	ADAAG requires signage to be mounted 60" from the floor, on the wall adjacent to latch side of door, to have raised characters and Braille text. Lower signage and add Grade II Braille text.	L: Signs are legible and provide direction.	\$4,000	Elkhart County General Fund			
4. Various Service Counters	3	Most service counters exceed the maximum height. The average counter top is 40" high. (4 counters)	7.2	ADAAG requires sale and service counters to have a maximum height of 36" above the finished floor. Lower portion of counter or provide auxiliary counter at 36" height.	M: Majority of customers use a counter in this building. Employee can walk around counter to communicate.	\$2,000	Elkhart County General Fund			


Location		Structural Inconsistencies		Recommended Corrections/Modifications to Provide Access	Technical Information			Finalized Actions		
Location	Photo	Identified Issue	ADAAG Specification		Priority Ranking and Justification	Improvement Cost	Funding Source	Finalized Correction	Anticipated Date of Completion	Date of Completion
5. Drinking Fountain	6	Water fountain is not cane detectable. Bottom of the fountain is 29" from the ground.	4.15	ADAAG requires objects projecting from walls with their leading edges between 27 and 80" above the finished floor to protrude no more than 4" into walks, halls, corridors, passageways, or aisles. Place something on the ground near water fountain so that the unit is cane detectable.	M: This is a relatively easy and inexpensive fix and may eliminate an injury.	\$50	Elkhart County General Fund			



01. Elkhart Health Dept Accessible Parking (2)



02. Elkhart Health Dept Accessible Parking

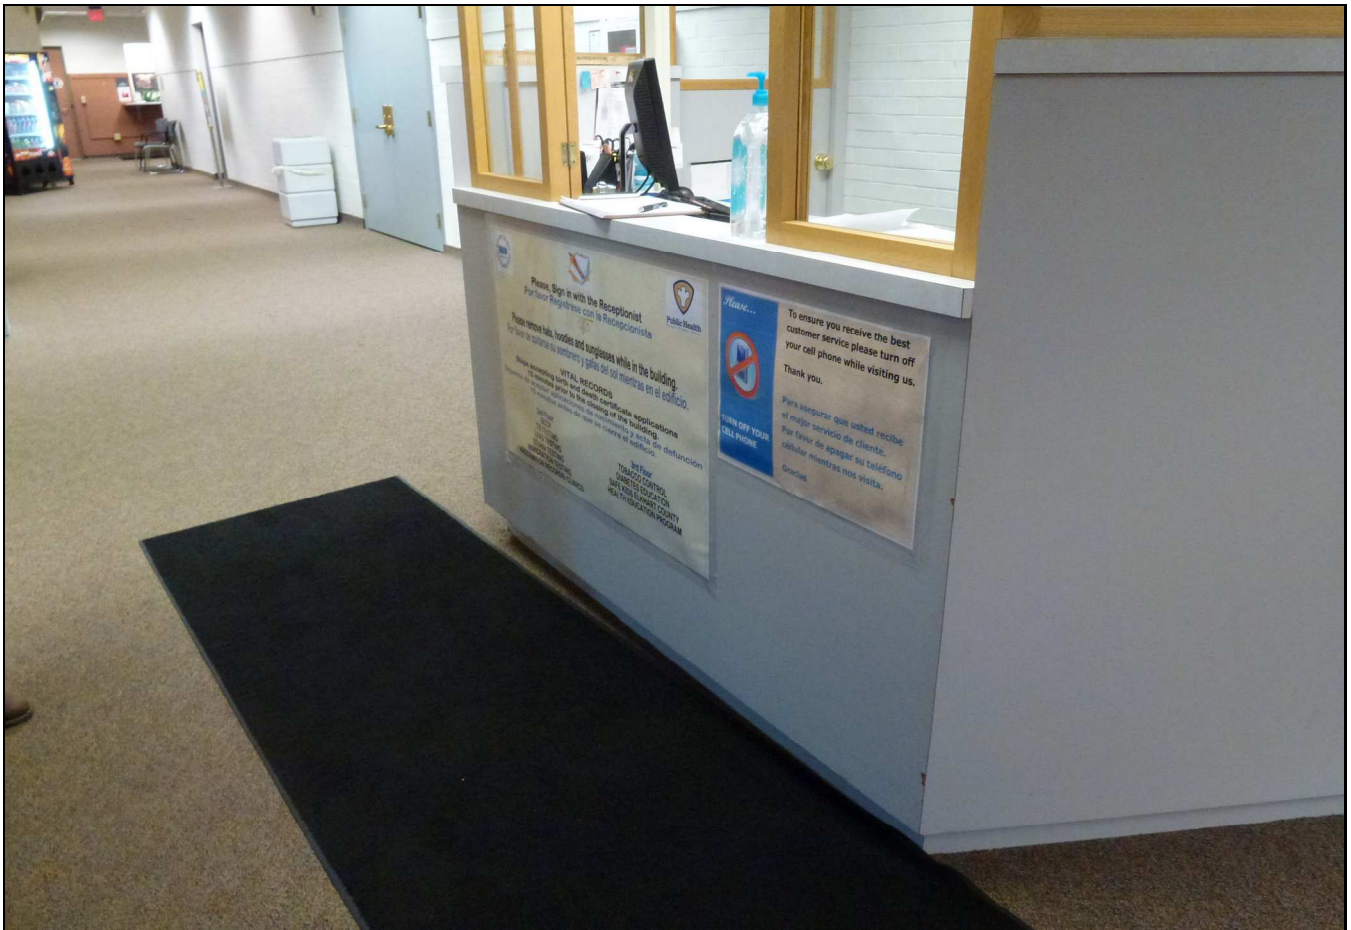

03. Elkhart Health Dept Service Counter



04. Elkhart Health Dept General Signage



05. Elkhart Health Dept Restroom Signage (2)